

TO: Old Beza Hospital Reserve Trust  
c/- Michael Marshman, A Plc.

Job: Old Beza Hospital  
5th Beza

Job No: AJ 3585

Date: 26.2.06.

ATTENTION:


**SITE INSPECTION REPORT/INSTRUCTION.**

Chimney Support (at roof/ceiling) instruction.

All chimneys are to be flanked (i.e. fixed to) by 2 roof/ceiling trusses on parallel faces of chimney.

Perpendicular chimney faces are to be timber blocked with 90 x 45 F.F kd pine members to reach ceiling and roof chord of truss. i.e. fixed to AS1684 i.e. AS1720 requirements i.e. BCA. Roof i.e. ceiling battens locate here also.

Chimneys are to be fixed to truss top i.e. bottom chords and perpendicular blocking members with 2 equally spaced M10 chemset or epoxy set (to brickwork) anchors bolt fixed with nut i.e. washer through appropriate vertically slotted holes in truss chords to allow for truss vertical deflection up i.e. down so as not to load trusses onto anchors.

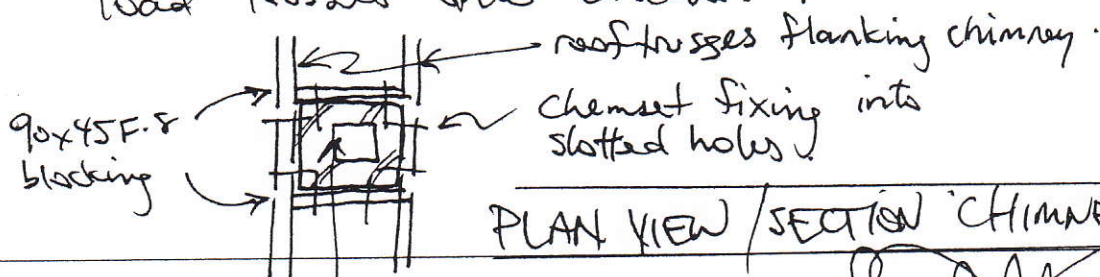

Copy to:

Chimney

Engineer:

*[Signature]*

TO: Old Bega Hospital Reserve Trust.  
 PO Box 382  
 Bega

ATTENTION: c/- Michael Marshman; Assoc & Pl

Job: Old Bega Hospital  
 Sth Bega.


Job No: A33585

Date: 26.2.06.

**SITE INSPECTION REPORT/INSTRUCTION .**

Roof tie down detail.


Pre fabricated timber roof truss tie down connection to  $\#$  as specified by other iaw BCA.

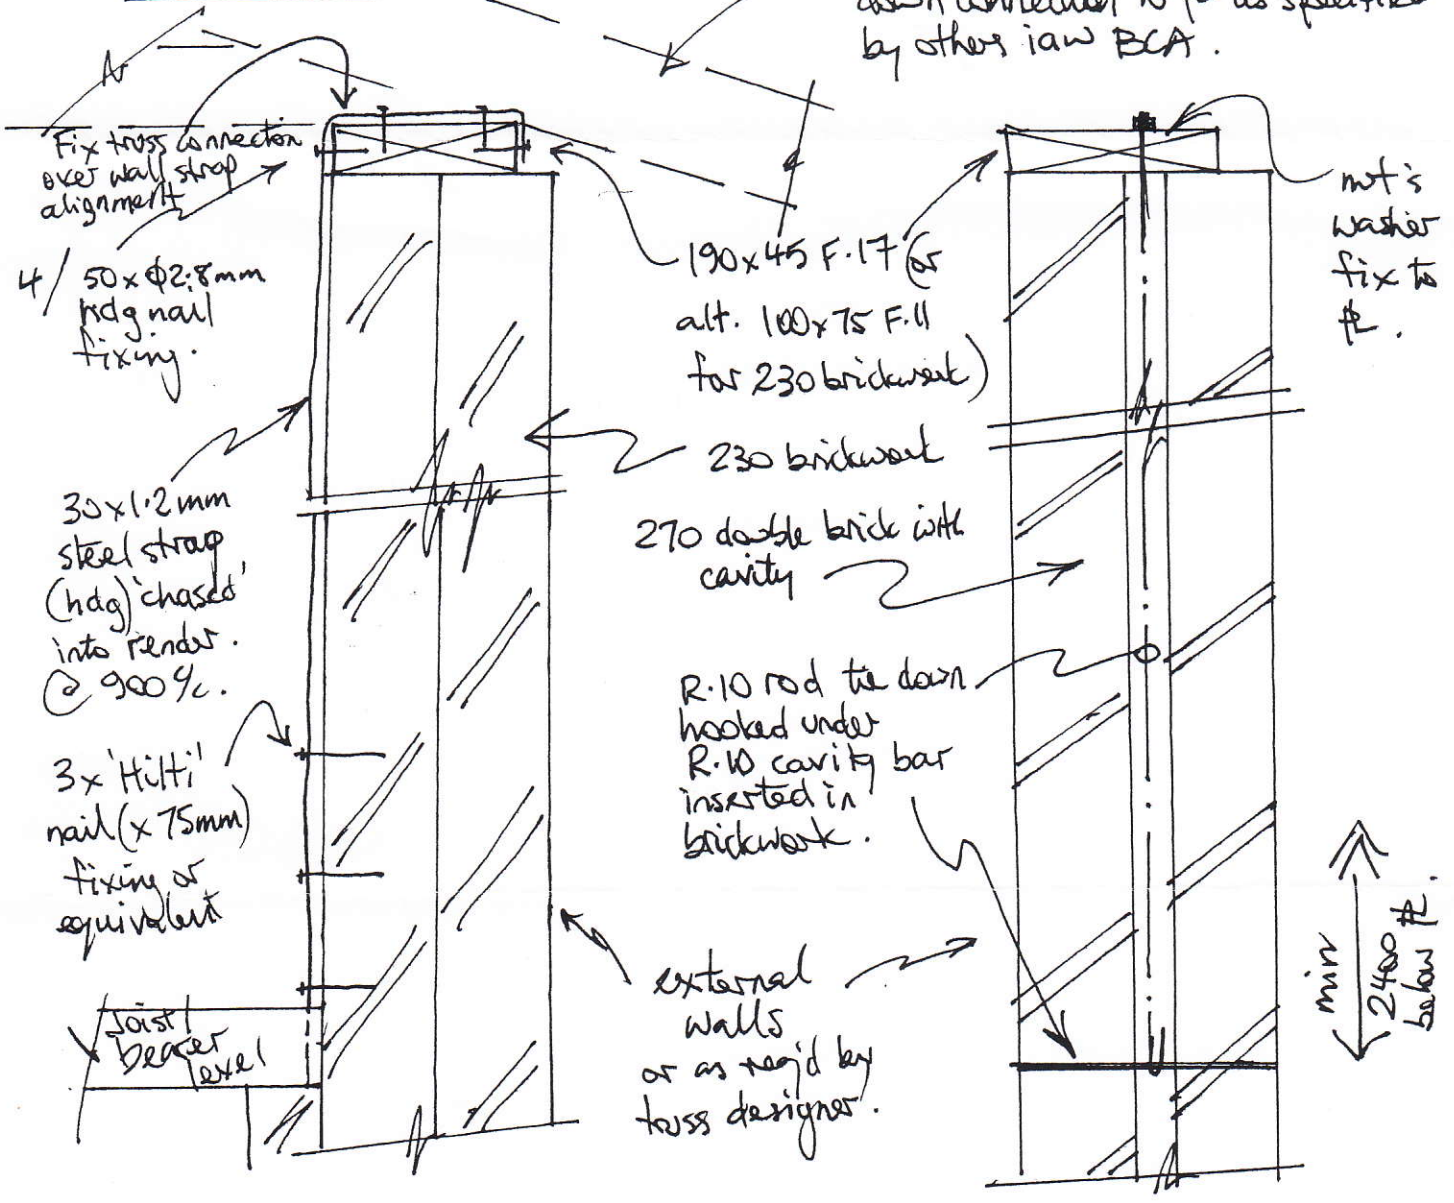

TYPICAL TOP  $\#$  TIE DOWN SECTIONS.

(NTS)

Copy to:

  
 Engineer: